

 
Installation

Cable Preparation Details


N-204

N-205


connector body



centre contact

 


crimp sleeve

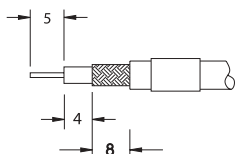


Cable Preparation

 1. Slide crimp ferrule onto cable.
2. Strip cable to recommended dimensions shown




Solder center contact to cable center conductor

1. Insert cable center conductor into center contact until it butts against cable dielectric.
2. Solder center contact

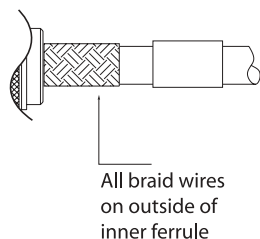

Attach cable to connector body

1. Insert cable assembly into rear of connector body, with all braid wires on outside of inner ferrule.
2. Push cable assembly forward until contact snaps into place in insulator.

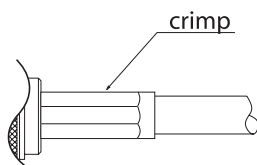

Final Assembly

1. Slide crimp ferrule forward until flush with connector body and crimp. Use C2CRT, RCT-214, CTBC crimp tool.



RF Industries Pty Ltd

ABN 11 001 695 512